

# VAN'S AIRCRAFT, INC.

14401 Keil Road NE, Aurora, Oregon, USA 97002

PHONE 503-678-6545 • FAX 503-678-6560 • [www.vansaircraft.com](http://www.vansaircraft.com) • [info@vansaircraft.com](mailto:info@vansaircraft.com)  
Service Letters and Bulletins: <http://www.vansaircraft.com/public/notices.htm>

---

## NOTIFICATION

**Date:** August 31, 2012

**Subject:** Wiring change for Skyview Version 4.0 firmware update

**Affected Parts:** Harnesses WH-00045 (Finish kits shipped after Aug 2011) and WH-00026 (12 SV FIN CONV kits shipped prior to 8/28/12).

Harnesses shipped after 8/28/12 are not affected.

**Synopsis:** These harnesses require pins to be swapped for the Skyview system to work correctly once the firmware update has been performed

**Recommended Action:** Both Harnesses:  
Swap pins 3 and 4 at the "Options" 37 pin d-sub that connects to the AV-50000A Control Module. These may have white wires, or blue/white and green/white wires.

Use the TOOL ICM INSRT/EXTRCT.

If the pin breaks off, replacements are available, part ES SA-1017