

VAN'S AIRCRAFT, INC.

14401 NE Keil Road, Aurora, Oregon, USA 97002

PHONE 503-678-6545 • FAX 503-678-6560 • www.vansaircraft.com • info@vansaircraft.com

Service letter: October 18, 2006

Subject: #2 Battery Cables

Affected Models: All RVs

It has come to the attention of Van's Aircraft that some #2 battery cable terminals may have been improperly crimped.

If you received any of the specified cables in the period 05/2006 to 10/2006 either in the wiring harness kits or bought individually, check the security of the crimped terminals as follows. Cables received outside this period should be unaffected, but builders may choose to check them.

Clamp one terminal in a vice and put a ¼" or 5/16" dowel through the other terminal to provide a handle to pull on it. Exert a moderate pull force so that if the crimps are good, the terminals will not be damaged. If they are not properly crimped then a pull of approximately 40lb or less will be sufficient to detach one terminal.

If one or both ends fail, return the cable(s) to Vans and we will provide replacements.

Affected cables:

WH-P10
WH-P11
WH-P14
WH-P15
WH-P16
WH-P17
WH-P18
WH-P19
WH-P25
WH-P26
WH-P27
WH-P4
WH-P4F
WH-P5
WH-P6