



14401 Keil Road NE, Aurora, Oregon, USA 97002
PHONE 503-678-6545 • FAX 503-678-6560
www.vansaircraft.com • info@vansaircraft.com

RV-12iS Sections 53AiS/U and 53BiS/U Revision Description

REASON FOR REVISION:

AN SPACER, 6D was too thick for installation of AV-00014 ADS-B Rod Antenna. AN SPACER, 6D replaced by F-00211.

REVISION DESCRIPTION:

KAI Page 53AiS/U-02 REV 1: In detail view of Figure 1, "F-00211" was "AN SPACER, 6D". "2 [50.8 mm]" was "1 1/4 [31.8 mm]". Clarified that nut and washer are supplied with AV-00014.

KAI Page 53BiS/U-02 REV 1: In detail view of Figure 2, "F-00211" was "AN SPACER, 6D". "2 [50.8 mm]" was "1 1/4 [31.8 mm]". Clarified that nut and washer are supplied with AV-00014.

PART CHANGES:

F-00211 - moved to R0

KIT INVENTORY CHANGES:

Remove from the RV-12 ADS-B-In G3X Kit-iS (Bag 3421)
Qty 1 AN SPACER, 6D

Remove from the RV-12 ADS-B-In w/XM G3X Kit-iS (Bag 3421)
Qty 1 AN SPACER, 6D

Remove from the RV-12 ADS-B SkyView Kit-iS (Bag 3413)
Qty 1 AN SPACER, 6D

Add to the RV-12 ADS-B-In G3X Kit-iS (Bag 3421)
Qty 1 F-00211

Add to the RV-12 ADS-B-In w/XM G3X Kit-iS (Bag 3421)
Qty 1 F-00211

Add to the RV-12 ADS-B SkyView Kit-iS (Bag 3413)
Qty 1 F-00211